

OK d' 12/3/17

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

U/R

158274

Page 1

Item ID: D119-646-041 Accept *N900040100* Setup Start *NS1*
 Revision ID: URF 15-560 Stop *NS2*
 Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
 Start Date: 3/20/2017 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 4/10/2017 Req'd Qty: 1.00 *1* Customer:
 Reference: SCHEDULED/C

Approvals: Process Plan: DAS 21 Date: MAR 16 2017 Tooling: _____ Date: _____ Run Start *NR1*
 QC: 9-89 Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D3887-041	D
IIN-D119-646	C

100

0.00

100

DC

Doc.Control -USB or Paperwork

Memo

0.00

Photocopy bluefile & type labels per PPP D119-646-041 CHG004

110

0.00

110

Skidtubes

Skidtubes

Memo

0.00

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

1 MB67 17/03/21

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 158274***158274***

Page 2

Thursday, March 16, 2017 2:36:50 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool#	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.72							
Hand Finishing									
121	QC7-Inspect Chemical Conversion Coat	0.00							
121									
QC	Memo	0.00							
Quality Control									
122	QC5- Inspect part completeness to step on W/O	0.00							
122									
QC	Memo	0.00							
Quality Control									

1 MGG 17/03/23

DAS 03 9-88 DP 17-3-24

DAS 03 9-88 DP 17-3-24

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274

Page 3

Item ID: D119-646-041 Accept

Revision ID: URF 15-560

Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017 Start Qty: 1.00 *1*

Required Date: 4/10/2017 Req'd Qty: 1.00 *1*

Reference: SCHEDULED/C

N900040100Setup Start ***NS1***Stop ***NS2***

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130		0.00				1	0	17-03-24	DT
130									
Skidtubes	Memo	0.00							
Skidtubes	1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.								
	2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.								
	3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477								
	4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***								
	5- Deburr, blow out chips from inside of tube.								
	6- Bond web in place as per Dwg D3887 & QSI 015.								
	A/R Sikaflex-291 <u>M136652</u>								
	Sikaflex expire date: <u>17-03-07</u>								
	Start: _____ Time: _____								
	Finish: _____ Time: <u>9:00</u>								
	***** (Adhere for 12 hours) *****								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 158274***158274***

Page 4

Thursday, March 16, 2017 2:36:50 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

135

QC5- Inspect part completeness to step on W/O

0.00


135

QC

Memo

0.00

Quality Control



DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By																																																							
								Lead hand / Supervisor Approval Verification																																																							
										QC / QA Coordinator Approval																																																					
Root Cause		FAULT CATEGORY																																																													
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	No Re-verification ☐	Operator ☐	Offset/Setup ☐	Supplier ☐	Training ☐	Use for Testing ☐	Poor Information ☐	Rushing ☐	Product Improvement ☐	Process Improvement ☐	Manufacturing Process ☐	Past Due ☐	Pressure/Forced ☐	Bending ☐	Centre Not Concentric ☐	Cracks ☐	Crimp/Kink/Ripple/Wave ☐	Cuffs ☐	Crushing ☐	Heat Treat ☐	Wave/Twist in Tube ☐	Marks/Chatter ☐	Temperature/Cure ☐	Set-up ☐	BOM/Route ☐	Broken/Damage/Defect ☐	Inspection Incomplete/Unqualified ☐	Contamination ☐	Countersink ☐	Cut Too Short ☐	Instructions Incomplete/Unclear ☐	Drill Holes ☐	Power Loss/Surge ☐	Folio/Program ☐	Grain ☐	Weld ☐	Wrong Stock Pulled ☐	Out of Sequence ☐	Off-set ☐	Mislabeled ☐	Fit/Function ☐	Misaligned/off center ☐	Positioned Wrong ☐	Outside Dimensions ☐	Over/Under tolerance ☐	Part Incorrect ☐	Part Lost/Missing ☐	Part Moved ☐	Drawing ☐	Finish ☐	Misread ☐	Turning Sequence ☐
OTHER : ☐																																																															

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274

Page 5

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 *1* Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 *1* Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

140

Skidtubes

Skidtubes

Memo

0.00

1- Bend FWD end of tube using bender 1 and FOLIO 31 bend prog.
D3887.***Must use bending aid DT9544, ensure proper positioning***

2- Cut FWD end of tube as per dwg D3887.***Verify measurement***

3- Buff out marks left from bending ✓

4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208" ✓

5- Open FWD saddle holes to finished size as per dwg D3887 ✓

6- Drill FWD x-bolt spacer holes using DT9816 and open to finished
size.(verify measurement) ✓

7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify
measurement). Open to finished size. ✓

8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle
hole. (verify measurement) as per dwg. ✓

9- C'sink FWD cap hole as per detail "C" ✓

10- Drill holes for wearpads using DT8931, open to 0.297". ✓

11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr. ✓

12- Deburr and blow out chips from inside of tube. ✓

17-03-27
DT
TW

17-03-28
DT

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By 	
								Lead hand / Supervisor Approval Verification 	
								QC / QA Coordinator Approval 	

Root Cause			FAULT CATEGORY								
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274

Page 6

Item ID: D119-646-041 Accept ***N9000040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

QC5- Inspect part completeness to step on W/O

0.00

150

QC

Memo

0.00

Quality Control

DAS
18
3-201 0 170329

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐			

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274**Item ID:** D119-646-041**Accept*****N900040100*****Setup Start *****Revision ID:** URF 15-560**Stop *****Item Name:** AW119 Replacement Skidtube with Wearpads - Fits LH or RH**Start Date:** 3/20/2017 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 4/10/2017 **Req'd Qty:** 1.00***1*****Customer:****Reference:** SCHEDULED/C**Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop ***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reje Num
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	-------------

160

0.00

160

Skidtubes

Skidtubes

Memo

0.96

NOTE:TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD
GROUND HANDELING FIXTURE,IF FIXTURE FITS WELL THEN
PROCEED. FIXTURE DT10091.

1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to
back drill each hole before welding the other side. Use aluminum rod
A/RAluminum Rod M136158

2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.

3-Counterbore 5/16" x 0.750" deep as per Dwg D3887.

4- Deburr & Scribe batch # on Aft end of tube.

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Quality Control

Memo

0.00

TEST FIT USING FIXTURE DT10091.

8E17-03-31

17-04-06

DT.

DAS
38
9-88

APR 07 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274

Page 8

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	QC10- Inspect visual per QSI004- ground welds	0.00				1			DAS 38 8-86 APR 07 2017
180 QC Quality Control	Memo	0.00							

190	Pressure Wash per QSI005 4.3	0.00							
190 HandFinish Hand Finishing	Memo Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.	0.44							(X1) 2017/04/10 BER

200	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
200 Powdercoat Powder Coating	Memo START TIME: OVEN TEMPERATURE: FINISH TIME:	0.00							17-04-11 8:30 SEE Attached

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274

Page 9

Item ID: D119-646-041
Revision ID: URF 15-560
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00
Required Date: 4/10/2017 Req'd Qty: 1.00
Reference: SCHEDULED/C

Accept

N900040100Setup Start ***NS1***Stop ***NS2***

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	QC3- Inspect Part Finish	0.00							
210									
QC	Memo	0.00							
Quality Control									
220		0.00							
220									
HandFinish	Memo	0.00							
Hand Finishing	1-Install inserts as per Dwg D3887.								
230	QC5- Inspect part completeness to step on W/O	0.00							
230									
QC	Memo	0.00							
Quality Control									

DAS
15
9-89DAS
34
9-89

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274

Page 10

Item ID: D119-646-041 Accept ***N1900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240									
HandFinish									
Hand Finishing									
	Memo	0.00							
	1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers								
	A/R Sikaflex-240/-291 <u>M137127</u>								
	Sikaflex expire date: <u>12/12</u>								
	2-assemble o'ring to plug as per dwg D3492 and apply o'ring lube								
	A/R 55-o'ring lube batch: <u>M135473</u>								
	3 -Inspect for foreign objects as per QSI 024								
	4 -Install Aft Cap and seal with Sikaflex. Clean excess adhesive.								
	A/R Sikaflex-240/-291 <u>M137127</u>								
	Sikaflex expire date: <u>12/12</u>								
245	QC5- Inspect part completeness to step on W/O	0.00							
245									
QC									
Quality Control	Memo	0.00							

1270 598 M136701 18601

1

DAS
38
9-89

APR 12 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
								QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			OTHER : ☐																	

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274

Page 11

Item ID: D119-646-041 **Accept** ***N900040100*** **Setup** **Start** ***NS1***
Revision ID: URF 15-560 **Stop** ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 **Start Qty:** 1.00 ***1*** **Cust Item ID:**
Required Date: 4/10/2017 **Req'd Qty:** 1.00 ***1*** **Customer:**
Reference: SCHEDULED/C

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____ **Run** **Start** ***NR1***
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____ **Stop** ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

250 Wing Walk as per dwg QSI005 4.4 Batch M13705 0.00

250

HandFinish
Hand Finishing

Memo

0.00

1 x 4 00 12/04/11

251 QC5- Inspect part completeness to step on W/O 0.00

251

QC
Quality Control

Memo

0.00

1

DAS
38
9-89

APR 12 2017

260 Identify as per dwg & Stock Location: _____ 0.00

260

Packaging
Packaging

Memo

PPP159405 0.00

1 SmB
17/4/12

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval			
Root Cause		FAULT CATEGORY									
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____									
Misidentified ☐	Past Due ☐										

Work Order ID 158274

Thursday, March 16, 2017 2:36:50 PM

158274

Page 12

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270	QC21- Final Inspection - Work Order Release	0.00						DAS 21 9-89	APR 12 2017
270 QC Quality Control	Memo	0.00							

DAS
21
9-89
APR 12 2017

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Thursday, March 16, 2017 2:36:53 PM

Page 1

Work Order ID: 158274

158274

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC IPP rev B
10.02.22 per PAR 09-043 EC verified by:DD IPP REVC 12.11.05
(DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 13.03.20 per
chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured

No

110

Each

53.0000

1

1

D2500-1-190

Ext'n -I' Beam Tube 4"

**

Location

Loc Qty

Loc Code

HALL

53

151612

53

D2579

Manufactured

No

140

Each

30.0000

2

2

D2579

Crossbolt Spacer

**

Location

Loc Qty

Loc Code

LG001

30

141711

30

D2855-3

Manufactured

No

240

Each

25.0000

2

2

D2855-3

Cap

**

Location

Loc Qty

Loc Code

FP001

25

151614

22

153291

3

x2

M66 17/03/21

BE1703-29

lll 17/04/11

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

Picklist Print

Thursday, March 16, 2017 2:36:53 PM

Page 2

Work Order ID: 158274

158274

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1611-005

Purchased

No

240

Each

274.0000

16

16

NAS1611-005

O-RING

**

all 17/04/17

Location

Loc Qty

Loc Code

FP001

274

m136184

23

m136192

1

m136377

150

m137017

100

16

D3492-5

Manufactured

No

240

Each

134.0000

16

16

D3492-5

Plug

**

all 17/04/17

Location

Loc Qty

Loc Code

FP001

134

133396

8

136396

6

152195

16

152814

3

153738

70

154740

31

B155493

x16

D3672-1

Manufactured

No

240

Each

660.0000

2

2

D3672-1

Washer, Phenolic

**

all 17/04/17

Location

Loc Qty

Loc Code

FG

10

85222

10

FP001

650

112218

4

134785

146

150074

500

x2

Thursday, March 16, 2017 2:36:53 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QS1042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Thursday, March 16, 2017 2:36:53 PM

Page 3

Work Order ID: 158274

158274

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

D3681-1

Manufactured No

160

Each

80.0000

8

8

D3681-1

Spacer

Location

Loc Qty

Loc Code

LG001

80

145956

1

151967

4

155381

55

155806

20

8E170329
858384 x3

D3847-1

Manufactured No

240

Each

70.0000

5

5

D3847-1

Wearpad

Location

Loc Qty

Loc Code

FP001

70

153009

4

153010

11

153011

3

153503

14

155281

12

155776

18

156958

8

B158536

x5

D3847-11

Manufactured No

240

Each

23.0000

1

1

D3847-11

Wearpad

Location

Loc Qty

Loc Code

FP001

23

151985

4

151986

1

154225

2

154349

4

155829

6

157006

6

x1

Thursday, March 16, 2017 2:36:54 PM

Shop Packet Print

Page 3

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step # : _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Thursday, March 16, 2017 2:36:54 PM

Page 4

Work Order ID: 158274

158274

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

D3885-1

Manufactured No

140 Each

15.0000 1 1

D3885-1

Standard Web

**

17-03-24
D7.

Location

Loc Qty

Loc Code

LG002

15

152609

15

D3903-1

Manufactured No

160 Each

119.0000 12 12

D3903-1

Spacer

**

BL703-29

Location

Loc Qty

Loc Code

LG001

119

152993

1

154083

9

155755

96

156389

13

12

ALS4-1032-130

AELS4-1032-130 Purchased

No

220 Each

4,184.000 30 30

ALS4-1032-130

Rivnut

**

17/04/11

Location

Loc Qty

Loc Code

CCK007

4002

M136579

4002

X30

FG

50

FG

M135442

50

FP001

132

M133077

72

M135442

60

Thursday, March 16, 2017 2:36:54 PM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Page 5

Thursday, March 16, 2017 2:36:54 PM

Work Order ID: 158274

158274

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

AN3C5A

Purchased

No

240

Each

678.0000

32

32

AN3C5A

del 12/10/16

Bolt

Location

Loc Qty

Loc Code

FG

5

122800

5

FP001

102

M136648

102

OVER002

400

M136182

100

M136450

200

M136579

100

ST350

171

M134676

1

M135442

170

x32

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
		OTHER : ☐				

Picklist Print

Thursday, March 16, 2017 2:36:54 PM

Page 6

Work Order ID: 158274

158274

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

Each

3,179.000

32

NAS1149C0332R

WASHER

all 170411

Location

Loc Qty

Loc Code

FP001

284

m136741

46

m136975

238

GA

532

m133284

32

m136444

500

ST260a

2200

m135408

0

m135766 *

500

m135908

200

m136042

500

m136643

1000

ST266

163

m126319

42

m127831

54

m135466

67

132

MS24694-C52

Purchased

No

Each

68.0000

2

MS24694-C52

SCREW

all 170411

Location

Loc Qty

Loc Code

FP001

64

m135978

64

ST285

4

m127059

4

12

Thursday, March 16, 2017 2:36:54 PM

Shop Packet Print

Page 6

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Misabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

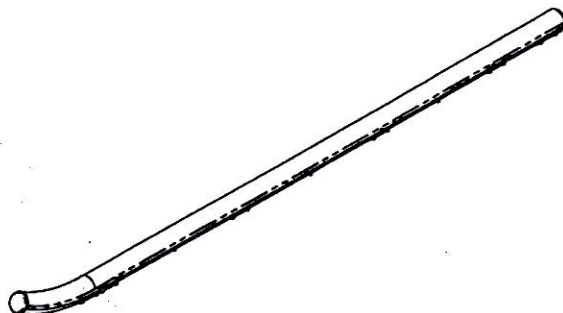

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/281 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO Ø0.197 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARPLATE INSERTS. INSTALL AELS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/281.

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2578	CROSS BOLT SPACER
11	2	2	2	D2855-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3672-1	PHENOLIC WASHER
14	8	8	8	D3681-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3903-1	SPACER
28			16	D3904-1	WASHER
41	30	30		ALS4-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C46A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN980C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24694-CS2	SCREW

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 158274 MJS
1703-16

RELEASED
2014 NOV 24
ECN 14-628
UNDER REVIEW
15.04.30 URF15-560 AP

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY: 135.07 WAS 134.04 (ZN D5-8), ADD 5.07 (ZN C2-8), ADD 116.8 (ZN D5-8), DELETE GASKETS (BOM, SH2)	DB	13.09.20
C	(SHT1, PL, ZN C2-2, C2-2 C4-2) ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24694-CS2 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) Ø0.201 CSK Ø0.305 X 100" WAS Ø0.214 THRU, ADDED DETAIL F (ZN C8-5, C8-6, B8-7), ADD ITEM 10, D2578 CROSS BOLT SPACER (ZN D4-1, A6-7)	DB	13.02.19
B	ALS4-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7); ADD DT8931 (ZN A6-1); ADD 134.04 (ZN C4-8); D2855-3 WAS D2575 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C8-2, C2-2, C8-3, C3-3, C4-1, C2-4); Ø0.313 WAS Ø0.328 (ZN C4-5, C4-5, C2-7 & B3-7) REVISED NOTE N (ZN B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR FOR THE REPRODUCTION OF ANY INFORMATION THEREIN WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

1.5
1.5
1.5
2.00 DISTANCE TO D3885-1 WEB, REF

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

AN3C5A BOLT
NAS1149C0332R WASHER
24 PL

PLUG UNUSED INSERTS WITH
AN3C5A BOLT
NAS1149C0332R WASHER
8 PL

D3847-1
WEARPAD
5 PL

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-CS2 SCREW
(1 PER SIDE)

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *up*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3CSA BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3CSA BOLT
NAS1149C0332R WASHER
30 PL

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

2.00 DISTANCE TO D3885-1 WEB, REF

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 q

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR DISSEMINATION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1148C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

AN3C46A BOLT
D3904-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

1.5
1.5
1.5

2.00 DISTANCE TO D3885-1 WEB

1.5
1.5

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3849-041
FWD TRAINING WEARPLATE ASSY

UNDER REVIEW


15.04.30 URF15-560 AP


RELEASED

2014 NOV 24 *dp*

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D3887	REV. D
MFG. APPR.	<i>[Signature]</i>	SHEET 4 OF 8	
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL AND IS SUPPLIED ON THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

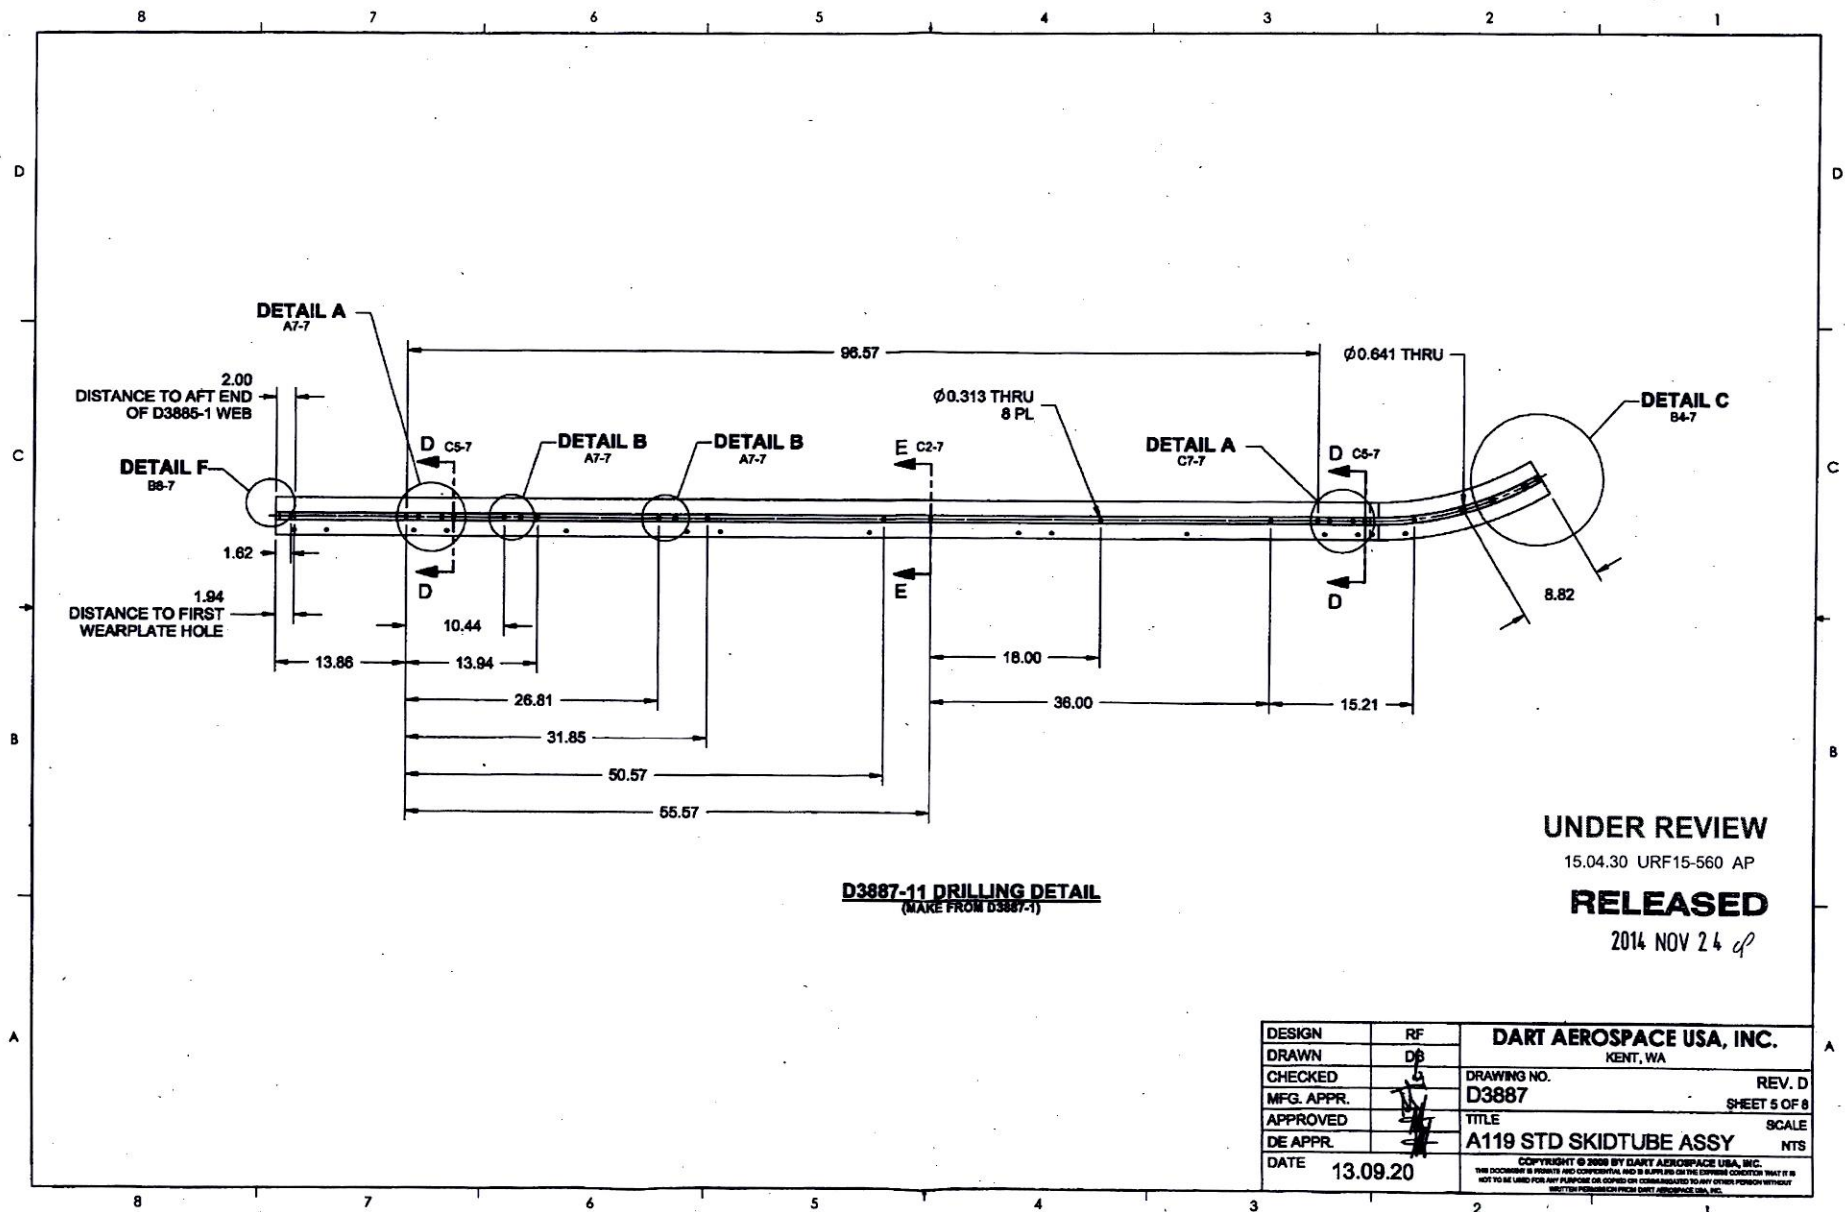

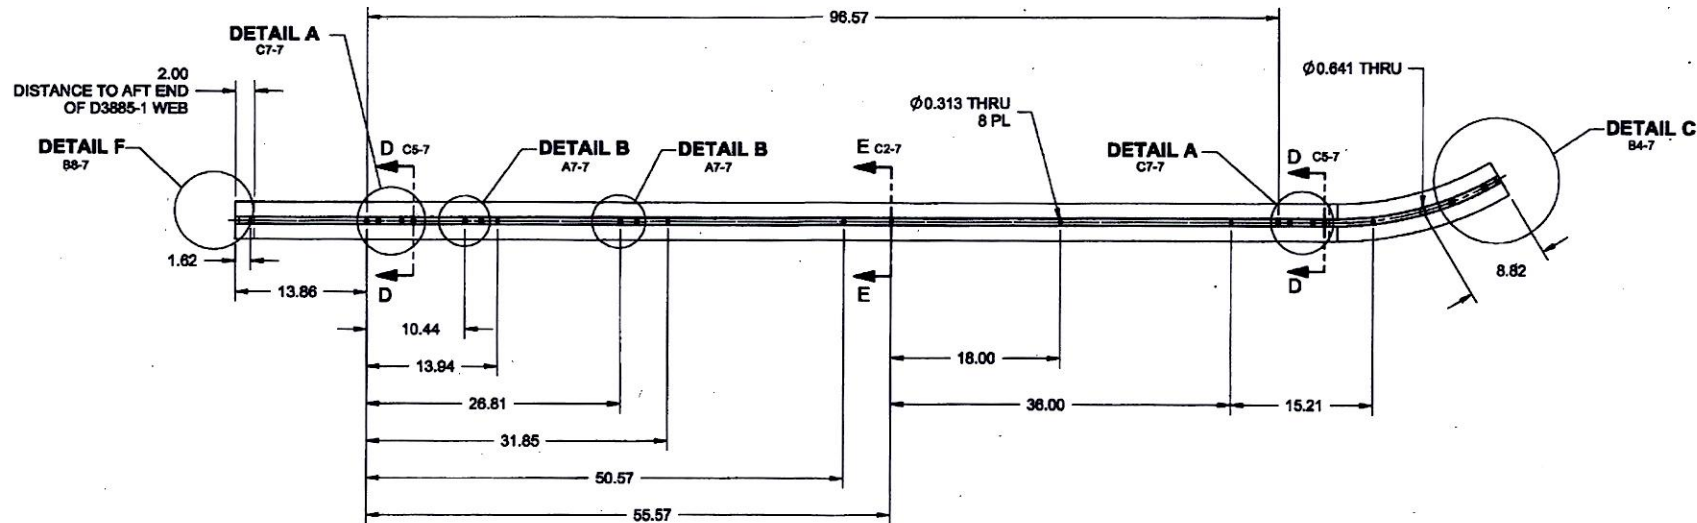

UNDER REVIEW


15.04.30 URF15-560 AP

RELEASED


2014 NOV 24 up

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

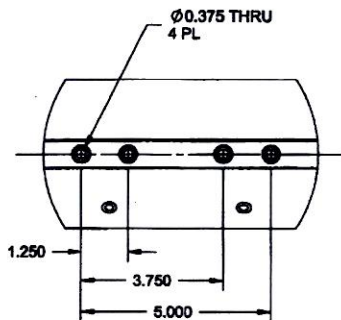


DETAIL A
SCALE 4X

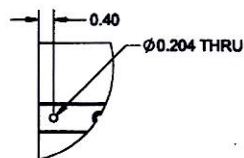


DETAIL F
SCALE 4X

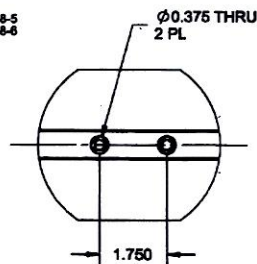


DETAIL B
SCALE 4X

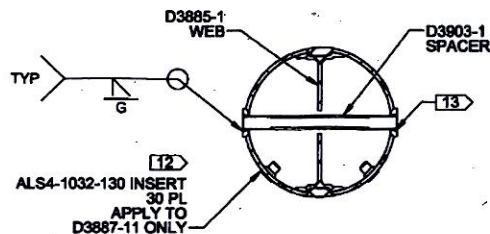

SECTION D-D
SCALE 4X
(FOR 12 X Ø0.375 HOLES
PER SKIDTUBE)

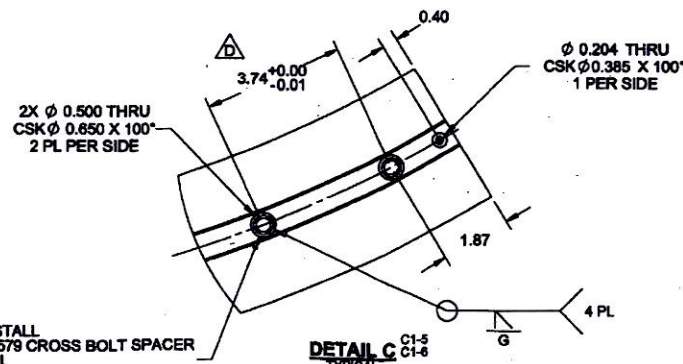

DETAIL C
TYPICAL
SCALE 4X

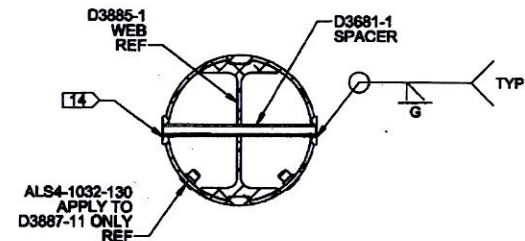

SECTION E-E
SCALE 4X
(FOR 8 X Ø0.313 HOLES
PER SKIDTUBE)

NOTES:

13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:

- i) CHAMFER HOLES Ø0.475 x 45°
- ii) INSERT D3903-1 SPACER
- iii) WELD INTO PLACE AND GRIND FLUSH
- iv) C'BORE TO 0.313 x 0.75 DEEP
- v) DEBURR HOLES

14) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.313 HOLES ONLY:

- vi) CHAMFER HOLES Ø0.354 x 45° OR 0.050 DEEP x 45° (BOTH SIDES)
- vii) INSERT D3681-1 SPACER
- viii) WELD INTO PLACE AND GRIND FLUSH
- ix) DEBURR HOLES


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS RECOGNITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

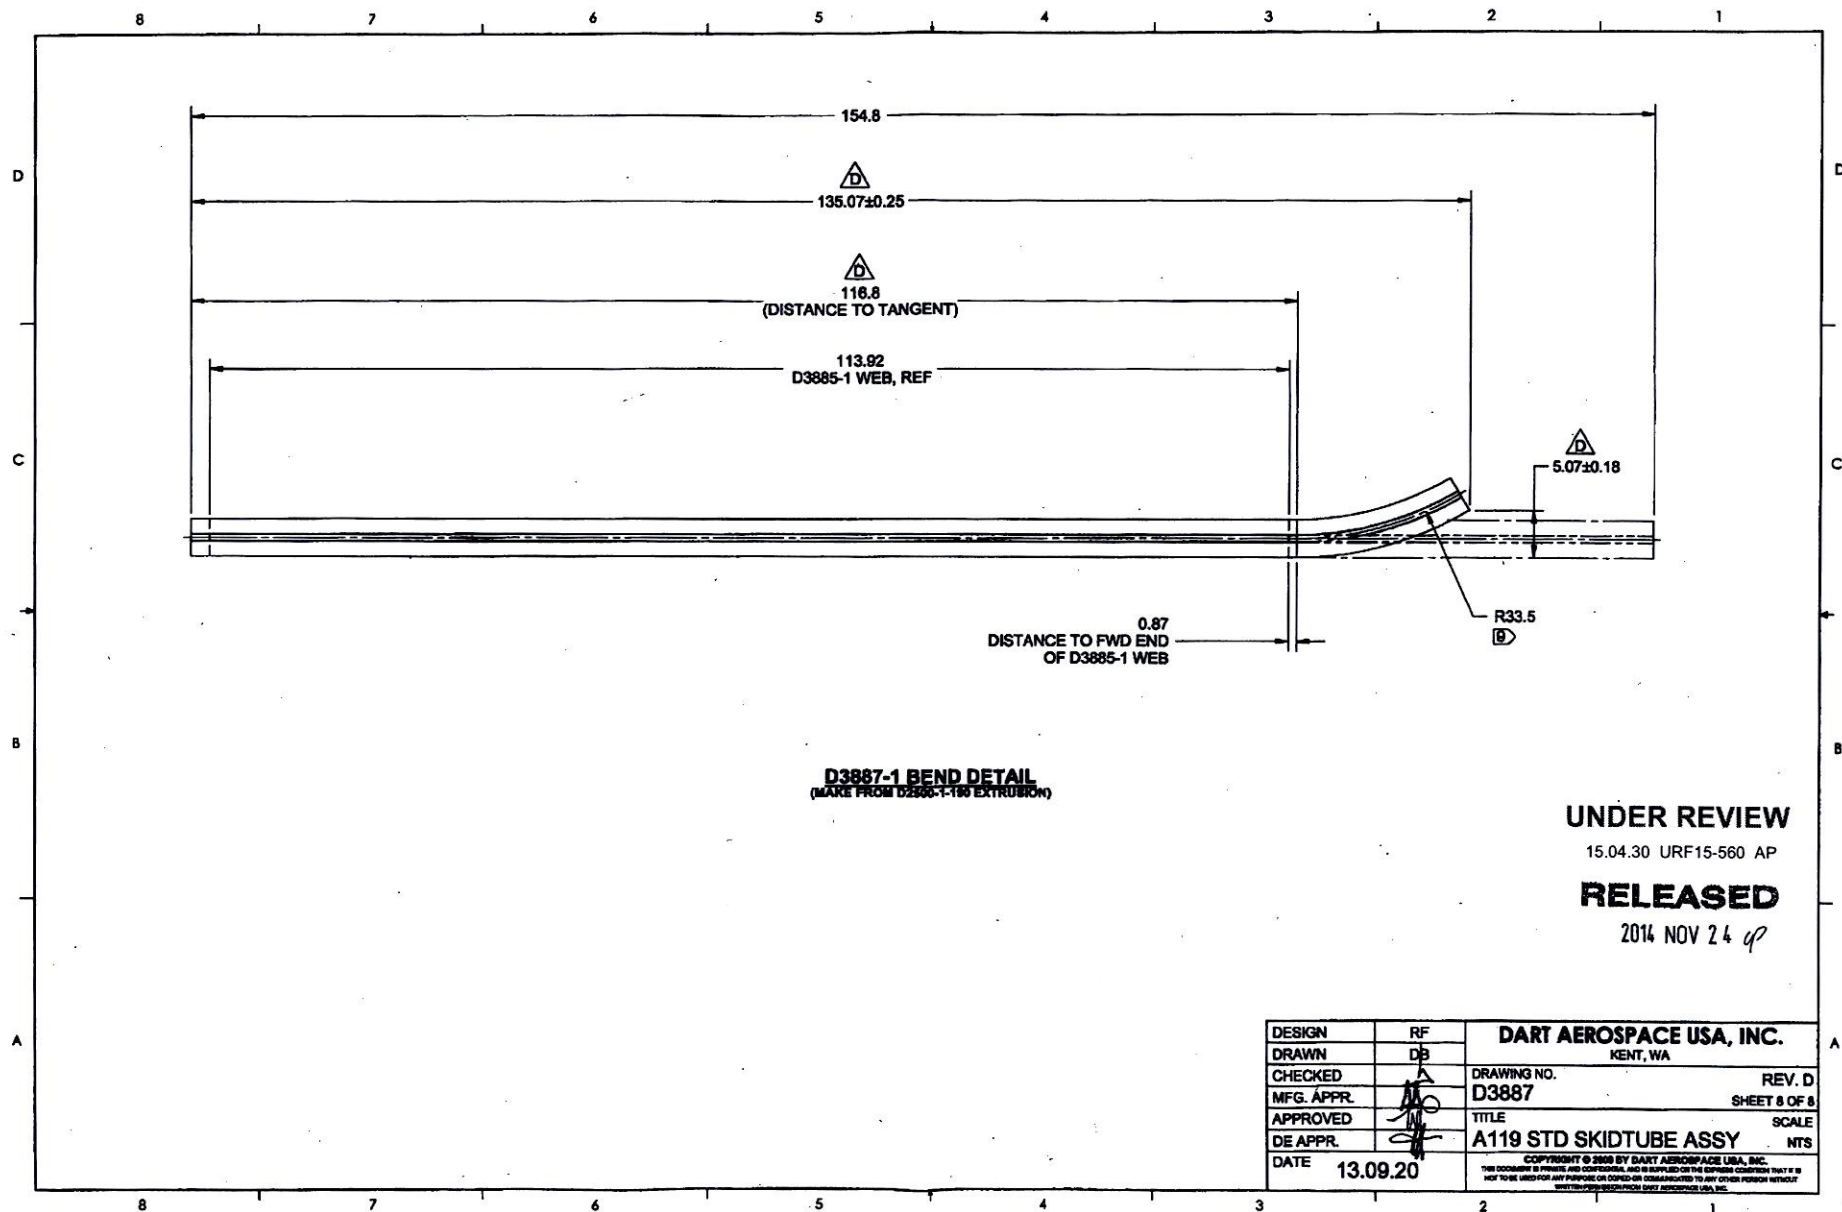

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date:

Work Order update only



Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☒</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date : 16/5/16		Step #: 200		QTY Effective : ①			MRB (QSI042) Approval DAS 12 17/3/17 9-89																		
Description Work Order Deviation				Disposition				Completed By 17-04-18 DAS 34 9-89 Lead hand / Supervisor Approval Verification DAS 9 17-04-18 9-89 QC / QA Coordinator DAS Approval 9 17-04-18 9-89																	
No powder coat on saddle region per customer request.				Acceptable per attached Masking instructions																					
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☒ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																				
		☒ OTHER : Customer																							

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☒

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☒ Quality ☐ Other ☐							
Date : 16/3/16		Step #: 240		QTY Effective : ①			MRB (QSI042) Approval DAS 12 17/3/17 9-89				
Description Work Order Deviation				Disposition							
Plug unused holes with AN3C4A Bolts rather than AN3CSA Bolts.				Acceptable AN3C-4A / M137075 (x6)							
				Completed by DAS 15 17/04/16 9-89							
				Lead hand / Supervisor Approval Verification DAS 9 17.04.13 9-89							
				QC / QA Coordinator Approval DAS 9 17.04.13 9-89							
Root Cause		FAULT CATEGORY									
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☒	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☒	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	☒ Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐								
Misidentified	☐	Past Due	☐	OTHER :							

